




# Huawei P10 Lite Battery Disconnection

Use this Guide to disconnect the battery of you...

Written By: Dominik Schnabelrauch

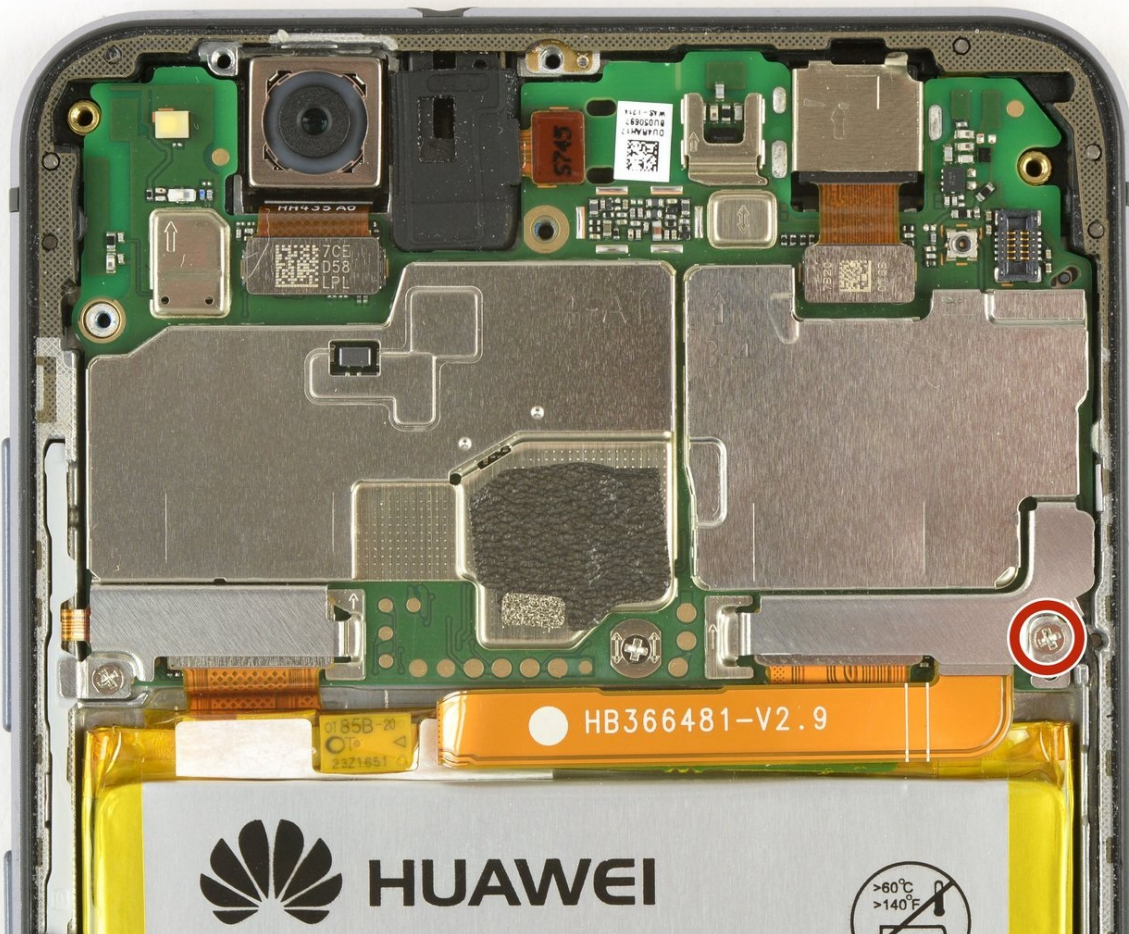

# INTRODUCTION

Use this Guide to disconnect the battery of you Huawei P10 Lite smartphone.

## TOOLS:

[Tweezers](#) (1)

[Spudger](#) (1)

[Phillips #00 Screwdriver](#) (1)

## Step 1 — Back cover




- Insert the tip of an opening pick between the back cover and the mid frame and slide it around the phone, to cut the adhesive.
  - Using a suction handle to lift the back cover may help to get an initial gap for the opening pick to put in.
- ⓘ If the adhesive is hard to cut, [use an iOpener](#) to loosen it.

## Step 2



- After you cut the adhesive on every edge, twist your opening pick, to separate the rear cover from the phone.
- Flip the rear cover over to the right side of the phone.


## Step 3

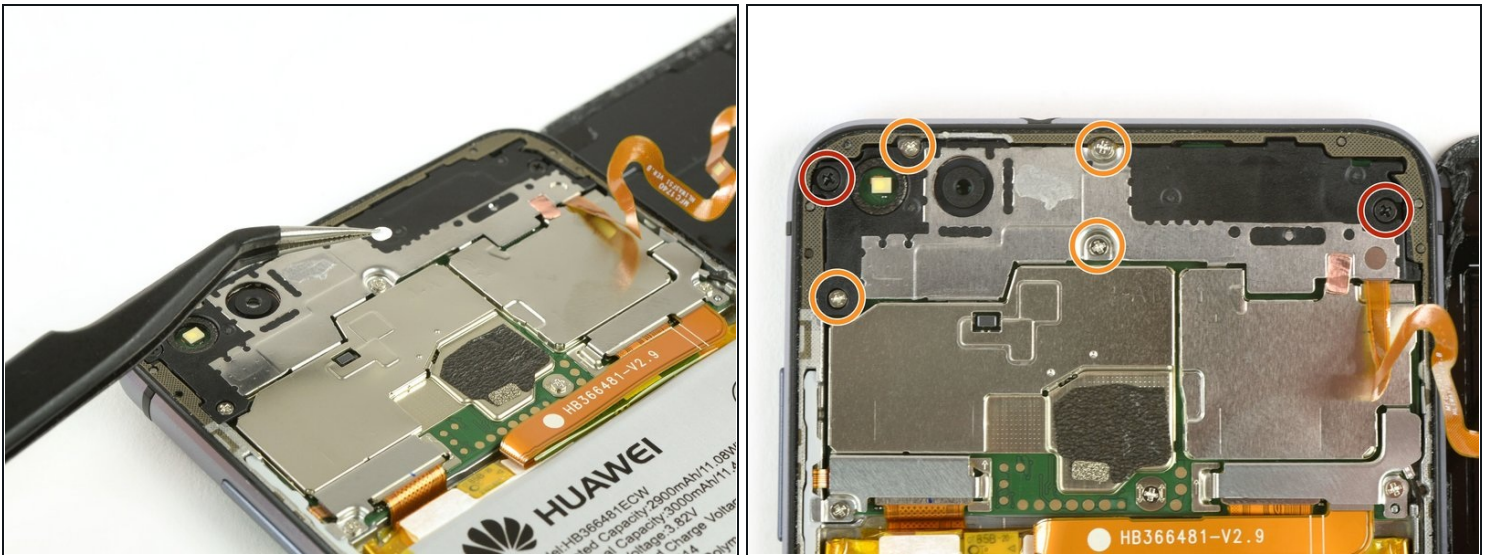

- Use a pair of [tweezers](#) to remove the sticker.
- Remove the two Phillips #00 screws.
- Remove the four 2.5 mm Phillips #00 screws.




## Step 4

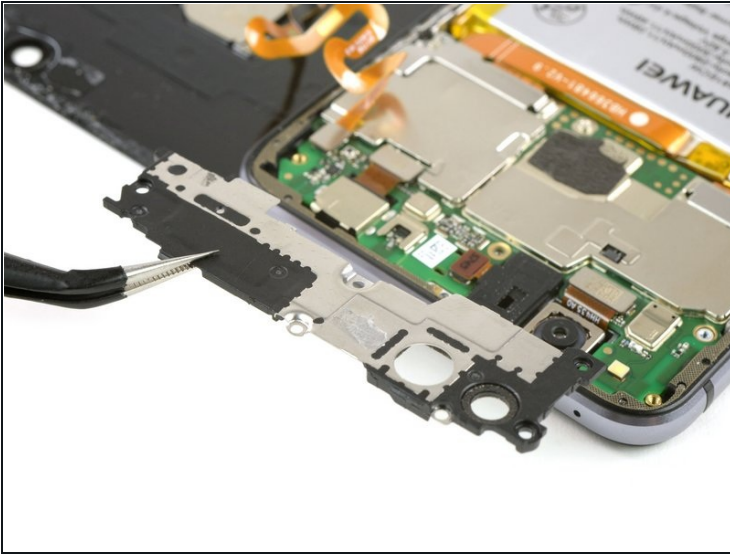

- Use tweezers to remove the mainboard shield.
- Use the flat end of a spudger to disconnect the finger print sensor flex cable.
  - ⓘ When reassembling apply new adhesive where it is necessary.

## Step 5 — Battery Disconnection

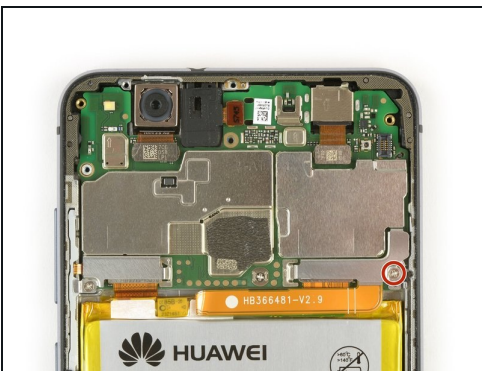

- Remove the Phillips screw holding the battery connector plate in place.
- Remove the battery connector plate.
- Use the flat end of a spudger to disconnect the battery flex cable.

To reassemble your device, follow these instructions in reverse order.