



Jazz UltraTab C855 Battery Replacement

This guide will walk you through the steps necessary to replace the battery

Written By: Cory Hodge



INTRODUCTION

Soldering skills are required to replace the battery in this device. Check out iFixit's [Soldering Skills](#) guide for more help.

TOOLS:

- [Wire Stripping/Crimping Tool](#) (1)
 - [Phillips #000 Screwdriver](#) (1)
 - [iFixit Opening Tools](#) (1)
 - [Soldering Iron](#) (1)
-

Step 1 — Back Cover




- Remove the 4 exterior screws using a [Phillips #000 Screwdriver](#).

Step 2




- Pry the back case off using the blue [Plastic Opening Tools](#). Work one along the seam until you can get your fingers under to pull it apart.

Step 3 — Battery

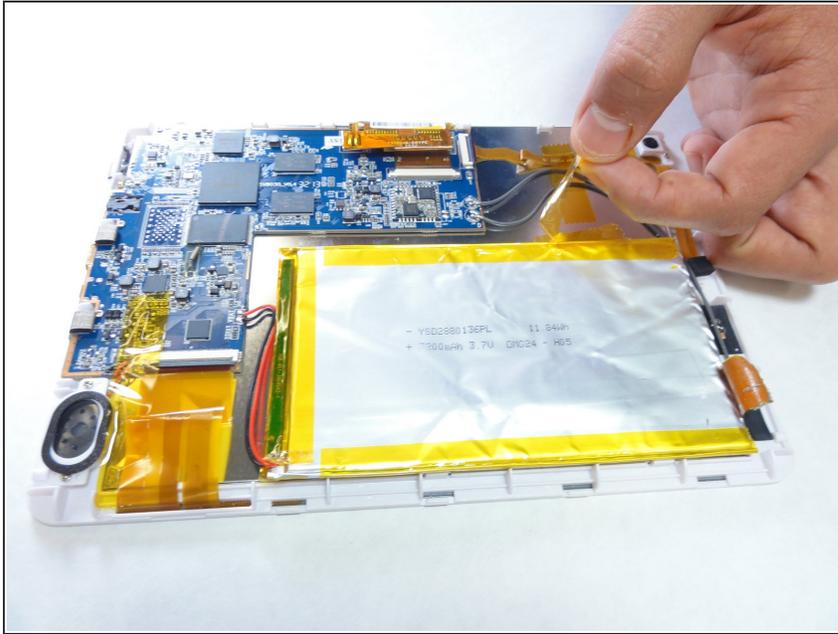


- Remove the yellow tape from the sides of the battery, and the surrounding components.

Step 4

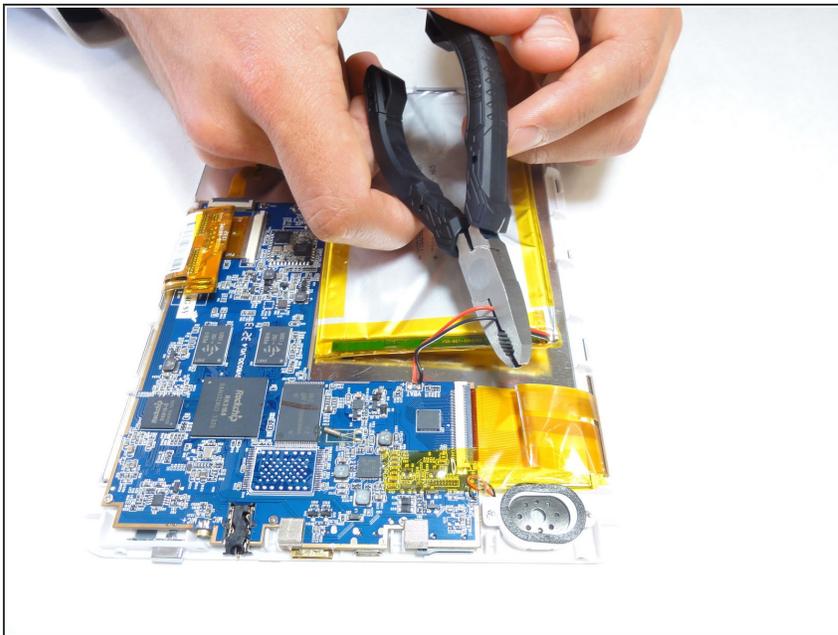

- Cut the pos(+) and neg (-) wires that connect the battery to the device using wire cutters.
- ✦ Cut the wires towards the middle. During installation of your new battery these wires will be stripped back and soldered or crimped to reattach.

Step 5

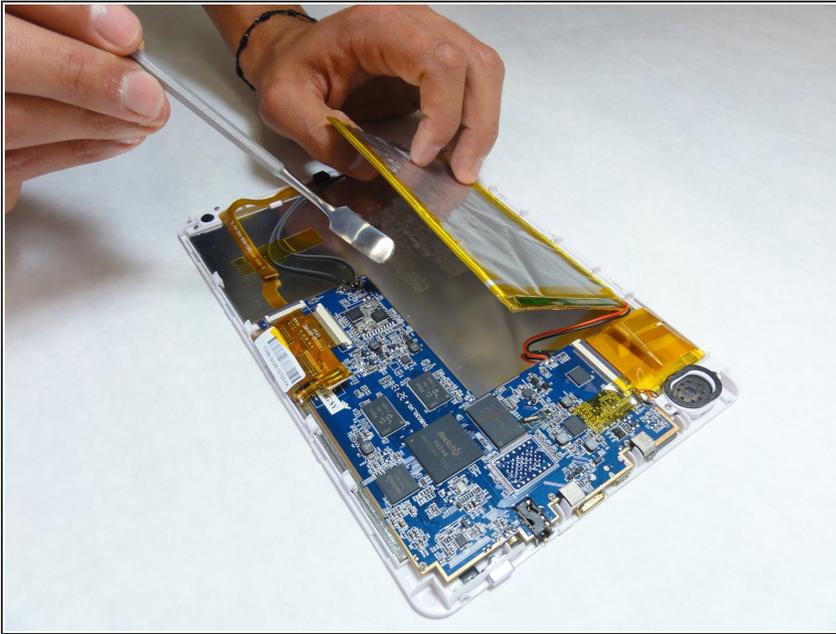

- Using a plastic opening tool or spudger, slowly pry the battery away from the board.
- ⓘ The battery is secured to the device with adhesive.
- ⚠ Metal spudgers can puncture an unprotected battery, potentially causing a fire. When working with electronics, it's important to choose a tool that's ESD-safe to avoid accidental damage to the device. The regular black nylon spudger or a plastic opening tool should be used whenever possible.

Step 6



- Use a two sided adhesive to secure the new battery in place.
- Solder or crimp the wires back together to reattach to the motherboard.
- Replace any yellow tape that you removed at the beginning to secure the wires back in place.

To reassemble your device, follow these instructions in reverse order.